

INSTRUCTION MANUAL


7 GAL. SUPPLEMENTAL TANK

Models: SG46, & SG52






7 GAL. SUPPLEMENTAL EXPLODED VIEW \ LEFT SIDE

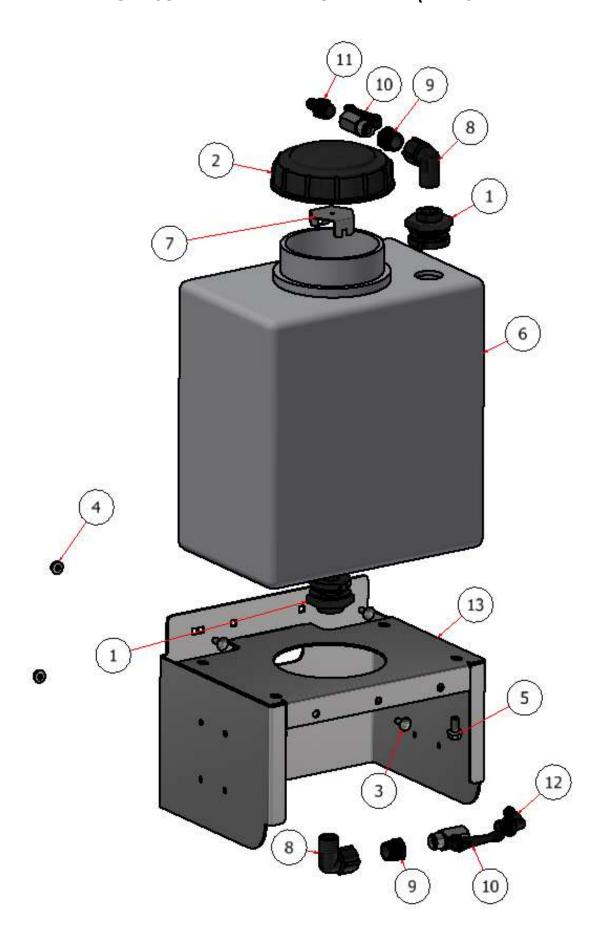

7 GAL. SUPPLEMENTAL EXPLODED VIEW \ LEFT SIDE

PARTS LIST							
ITEM	QTY	PART NUMBER	DESCRIPTION				
1	2	S51242	BULKHEAD FITTING, TANK				
2	1	S51243	CAP, TANK				
3	4	CB-51634	CARRIAGE BOLT, SS - 5/16-18 x 3/4				
4	4	HFNCS-516S	HEX FLANGE NUT, SS - 5/16-18				
5	4	HFSSC-3875	HEX FLANGE BOLT, 3/8 X 3/4				
6	1	M10007-R	TANK, 7 GALLON				
7	1	R21-113	ANTI VORTEX PLATE				
8	2	S52041	90 ELBOW, 3/4 MNPT X 3/4 FNPT				
9	2	S52051	BUSHING, PIPE, 3/4 X 1/2				
10	2	S51266	1/2 BALL VALVE				
11	1	S52013	1/2 MNPT X 1/2 HOSE BARB				
12	1	S52025	1/2 MPT X 1/2 BARB				
13	1	W22-183	TANK SUPPORT, 7 GAL. SG46/52				

7 GAL. SUPPLEMENTAL EXPLODED VIEW \ RIGHT SIDE

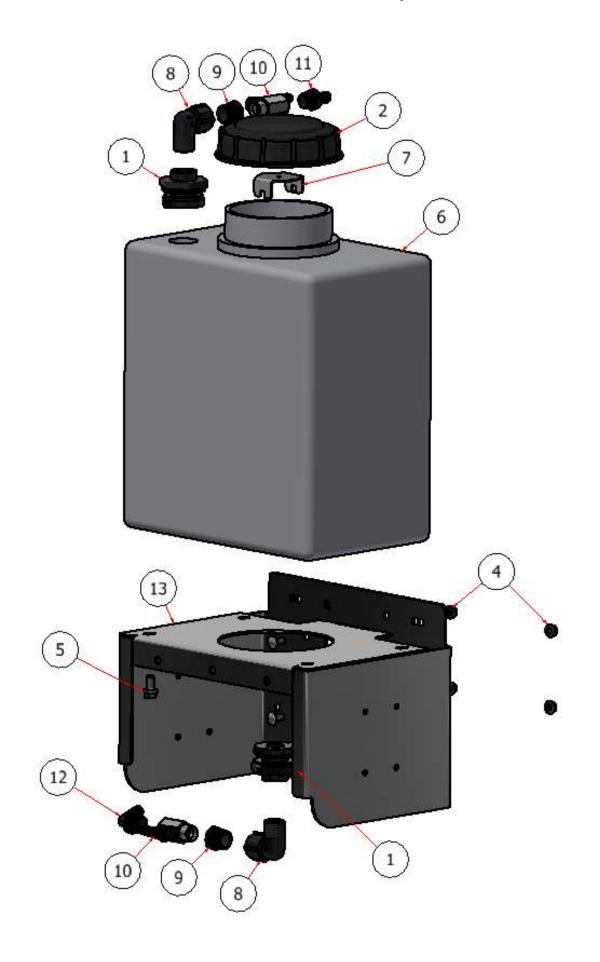

7 GAL. SUPPLEMENTAL EXPLODED VIEW \ RIGHT SIDE


PARTS LIST							
ITEM	QTY	PART NUMBER	DESCRIPTION				
1	2	S51242	BULKHEAD FITTING, TANK				
2	1	S51243	CAP, TANK				
3	4	CB-51634	CARRIAGE BOLT, SS - 5/16-18 x 3/4				
4	4	HFNCS-516S	HEX FLANGE NUT, SS - 5/16-18				
5	4	HFSSC-3875	HEX FLANGE BOLT, 3/8 X 3/4				
6	1	M10007-R	TANK, 7 GALLON				
7	1	R21-113	ANTI VORTEX PLATE				
8	2	S52041	90 ELBOW, 3/4 MNPT X 3/4 FNPT				
9	2	S52051	BUSHING, PIPE, 3/4 X 1/2				
10	2	S51266	1/2 BALL VALVE				
11	1	S52013	1/2 MNPT X 1/2 HOSE BARB				
12	1	S52025	1/2 MPT X 1/2 BARB				
13	1	W22-183	TANK SUPPORT, 7 GAL. SG46/52				

STEP ONE: Disconnect the battery, *ground* first and then *power* wire.



STEP TWO: Remove existing storage container and support bracket from the frame.


NOTE: Instructions are the same for the right and left side.

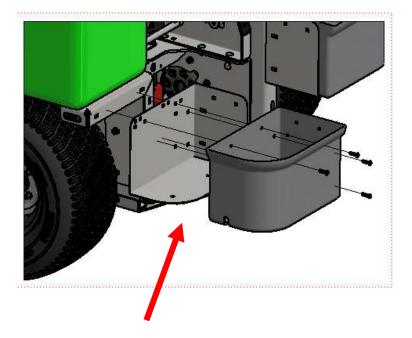

STEP THREE: Install the supplemental tank to the frame as shown.

NOTE:

- Instructions are the same for the right and left side.
- Parts shown clear for clarity.

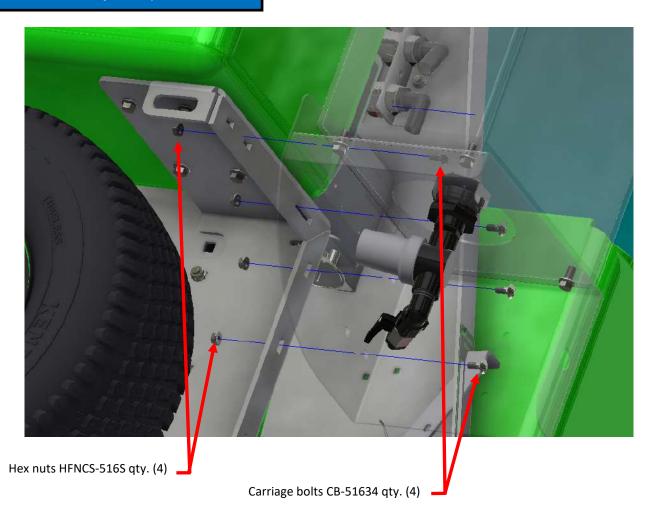


NOTE:

- Before beginning step four, BE SURE there is no pressure on the lines and fluid is drained.
- Parts removed for clarity.

STEP FOUR:

- Carefully cut and install the "tee" fittings in the "suction" and "return" lines as shown (blue arrows). Securely fasten with 3/4 hose clamps.
- Next install the 90 degree elbows.

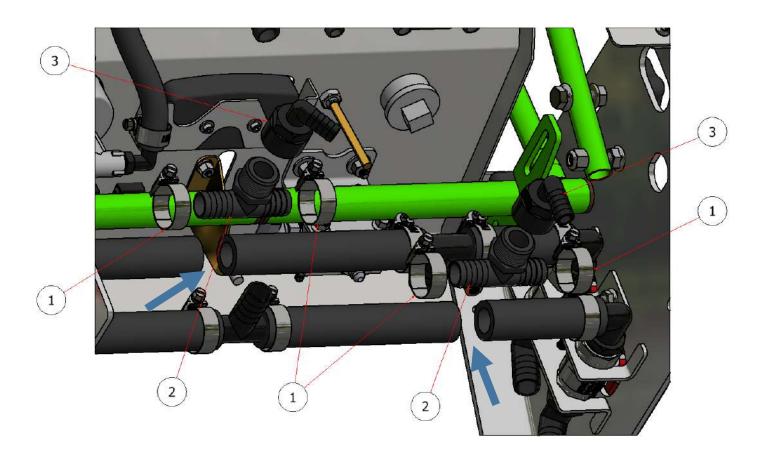



PARTS LIST								
ITEM	QTY	PART NUMBER	DESCRIPTION					
1	4	12HS	HOSE CLAMP, 3/4					
2	2	S52009	TEE FITTING, 3/4 HOSE X 3/4 MNPT					
3	2	S52035	3/4 FNPT X 1/2 HOSE BARB					

STEP FIVE:

NOTE: Slide the protective wrap over the hose and secure it with zip ties before connecting.

- Measure and cut 1/2" hose and connect one end to the suction port on the bottom of the 7 gallon tank and the other end to the "tee" fitting in the suction line.
- Route the hose between the upright and the tank.
- Securely fasten each end with 1/2" hose clamp.

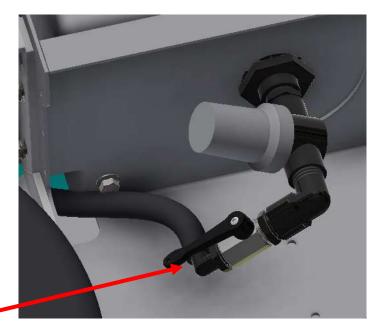


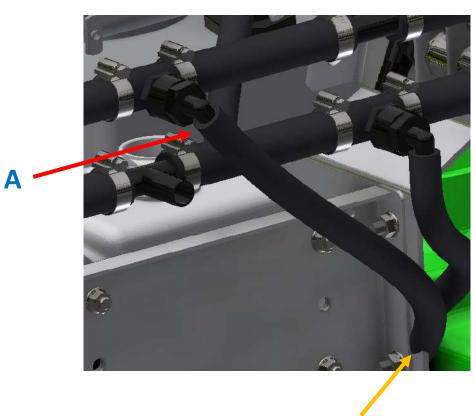


STEP SIX:


NOTE: Slide the protective wrap over the hose and secure it with zip ties before connecting.

- Measure and cut 1/2" hose, connecting one end to the return port on the top of the 7 gallon tank and the other end to the "tee" fitting in the return line.
- Route the hose between the upright and the tank.
- Securely fasten each end with 1/2" hose clamps.

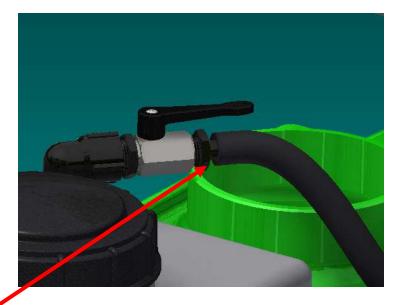

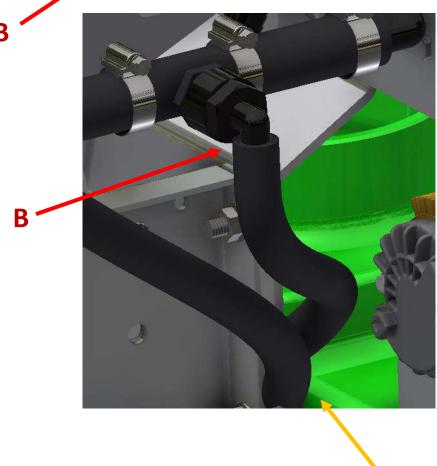

STEP SEVEN: Reconnect the battery *power wire* first along with the *pump power wire* from the wiring harness, and then reconnect the *ground* wire.

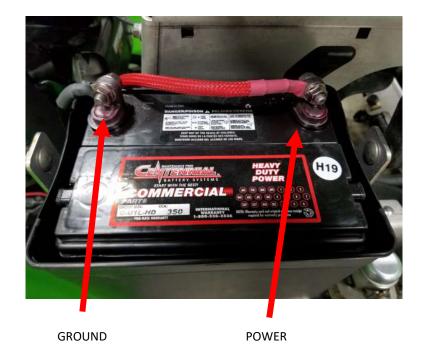



Steel Green Mfg. 824 S State Road 39 Lebanon, IN 46052 (765)-481-2890 www.steelgreenmfg.com

MANUAL	MANUAL	DESCRIPTION	KIT
PART NO.	REV.		PART NO.
SGM-011	В	SG46-52 7 GALLON SUPPLIMENTAL TANK	P10032